

# CRITICAL ITEMS LIST

ASSY NOMENCLATURE: EVA WINCH

SYSTEM: 4.1, 4.2 AND 4.3

ASSY P/N: SED 33101570

SUBSYSTEM: 5.3

PAGE 17 OF 72

| FMEA |     | NAME, QTY & DRAWING REF DESIGNATION | CRIT/Y | FAILURE MODE AND CAUSE                                      | FAILURE INJECTION  | END ITEM | RATIONALE FOR ACCEPTANCE  |
|------|-----|-------------------------------------|--------|---|--|----------|---|
| REF  | REV |                                     |        |   |  |          |   |
| 3A   |     | EVA WINCH, [2]<br>SED 33101570      | 2/FR   | Mode:<br>Hook breaks<br><br>Cause:<br>• Material<br>failure | 1. Unable to<br>cradle RMS which<br>prevents closing<br>payload bay<br>doors (mission<br>phase EVA, RMS).<br><br>2. Unable to<br>close payload bay<br>doors (mission<br>phase EVA,<br>doors).<br><br>Redundancy<br><br>1. RMS jettison<br>system.<br><br>2. Second EVA<br>winch. |          | <p><b>Design Features to Minimize Failure Mode:</b></p> <ul style="list-style-type: none"> <li>a. Safety factor of 1.4.</li> <li>b. Safety margin of 1.</li> <li>c. Working load of 584 lbs.</li> </ul> <p><b>Test or Analysis to Detect Failure Mode:</b></p> <p><b>Acceptance:</b></p> <p>Functional Test -- Complete functional testing to assure that the controls operate smoothly and that the rope can be extended and retracted.</p> <p><b>Certification:</b></p> <ul style="list-style-type: none"> <li>a. Qualification test consists of: working load test with 200 lb. and 600 lb. static loads, verification of smooth operation with static loads applied, verification that a max force (during one-hand operation) of approximately 50 lbs. is exerted during ratcheting with the crank grip in the 90° position</li> <li>b. Stress analysis to certify this tool for 584 lb. working load with 1.4 safety factor</li> <li>c. Thermal qualification testing to certify this tool for a temperature environment of -200°F to +350°F for 160 hour.</li> </ul> <p><b>Interface:</b></p> <ul style="list-style-type: none"> <li>a. Insert 1.25 diameter tube in hook, verify restrained by hook latch.</li> <li>b. Insert 1.12 diameter tube in hook, verify restrained by hook latch.</li> </ul> <p><b>Maintainability:</b></p> <ul style="list-style-type: none"> <li>a. Complete functional testing will be performed once a year, or after each mission use to assure that the controls operate smoothly and that the rope can be extended and retracted.</li> <li>b. Replace Kevlar rope after each mission use.</li> <li>c. Inspect Kevlar rope for fraying or other damage once a year.</li> </ul> |

PREPARED BY: R. T. Homan

REVIEWED BY: DATE

APPROVED BY: R. T. Homan

DATE: 0-00

100  
99  
98  
97  
96  
95  
94  
93  
92  
91  
90  
89  
88  
87  
86  
85  
84  
83  
82  
81  
80  
79  
78  
77  
76  
75  
74  
73  
72  
71  
70  
69  
68  
67  
66  
65  
64  
63  
62  
61  
60  
59  
58  
57  
56  
55  
54  
53  
52  
51  
50  
49  
48  
47  
46  
45  
44  
43  
42  
41  
40  
39  
38  
37  
36  
35  
34  
33  
32  
31  
30  
29  
28  
27  
26  
25  
24  
23  
22  
21  
20  
19  
18  
17  
16  
15  
14  
13  
12  
11  
10  
9  
8  
7  
6  
5  
4  
3  
2  
1  
0

R&S-19

# CRITICAL ITEMS LIST

ASSY NOMENCLATURE: EVA WINCH

SYSTEM: 4.1, 4.2 AND 4.3

ASSY P/N: SED 33101570

SUBSYSTEM: 5.3

PAGE 18 OF 72

| FMEA |     | NAME, QTY & DRAWING REF DESIGNATION               | CRIT'Y | FAILURE MODE AND CAUSE                                   | FAILURE EFFECT ON  | RATIONALE FOR ACCEPTANCE  |
|------|-----|---|--------|--|--|---|
| REF  | REV |   |        |  |  |   |
| 3A   |     | EVA WINCH, (2)<br><br>SED 33101570<br>(Continued) | 2/1R   | Mode:<br>Hook breaks<br><br>Cause:<br>• Material failure | 1. Unable to traddle RMS which prevents closing payload bay doors (mission phase EVA, RMS).<br><br>2. Unable to close payload bay doors (mission phase EVA, doors).<br><br>Redundancy -<br>1. RMS jettison system.<br><br>2. Second EVA winch. | <p>3. <b>Inspection</b><br/><br/><b>Manufacturing (Completed)</b><br/>a. Verify the as-built configuration.<br/>b. NDE testing, such as x-ray.<br/>c. Verify certificate of compliance for materials</p> <p><b>Turnaround</b><br/>a. Inspect for visible damage, surface contamination, and clean according to PS2B/PIA 05001<br/>b. Verify completion of functional test for reacceptance</p> <p>4. <b>Failure History.</b><br/><br/>JH0004 - A deterioration of the control handle positioning springs that correctly position the spool pawl. New springs and spring guides have been fabricated and installed on all winch assemblies, with the exception of S2B 1001, the qualification unit. All units fitted with the new spring guide assemblies were functionally tested by reeling out 5 feet of rope, retracting by automatic reel in and ratchet handle, and verify ratchet out feature. Reference JPS 2B22001B.</p> <p>5. <b>Operational Use.</b></p> <p>a. <b>Operational Effect of failure</b> Breakage of the hook would upset normal operations in that the winch rope could not be easily attached to the PLBD or the RMS rope reel</p> <p>b. <b>Crew Action</b> Several simple and common sense crew actions are possible. The rope can be tied directly to the PLBD and rope reel. It could also be tied to a wrist tether or a payload retention device and then that piece of hardware can be attached to the PLBD or rope reel</p> <p>c. <b>Crew Training</b> These crew actions will be incorporated into the EVA training flow</p> <p>d. <b>Mission constraints</b> None identified</p> <p>e. <b>In flight Checkoff</b> The crew will visually inspect the hook prior to use</p> |

S/N 02020-4  
PAGE 18 OF 72  
EVA WINCH  
5.3  
1  
1  
1  
1

CRS-18